Noise Monitoring Assessment

Dunloe Quarry, Pottsville, NSW Quarter 3 Ending September 2022



Prepared for: Holcim (Australia) Pty Ltd September 2022 MAC180611-07RP17

Document Information

Noise Monitoring Assessment

Dunloe Quarry, Pottsville, NSW

Quarter 3 Ending September 2022

Prepared for: Holcim (Australia) Pty Ltd

Prepared by: Muller Acoustic Consulting Pty Ltd PO Box 678, Kotara NSW 2289 ABN: 36 602 225 132 P: +61 2 4920 1833 www.mulleracoustic.com

Document ID	Date	Prepared By	Signed	Reviewed By	Signed
MAC180611-07RP17	7 September 2022	Nicholas Shipman	N.Shp	Rod Linnett	RHLA

DISCLAIMER

All documents produced by Muller Acoustic Consulting Pty Ltd (MAC) are prepared for a particular client's requirements and are based on a specific scope, circumstances and limitations derived between MAC and the client. Information and/or report(s) prepared by MAC may not be suitable for uses other than the original intended objective. No parties other than the client should use or reproduce any information and/or report(s) without obtaining permission from MAC. Any information and/or documents prepared by MAC is not to be reproduced, presented or reviewed except in full.



CONTENTS

1	11	NTRODUCTION	5
2	N	OISE CRITERIA	7
	2.1	ENVIRONMENTAL PROTECTION LICENSE (EPL 13077)	7
3	Ν	IETHODOLOGY	9
	3.1	LOCALITY	9
	3.2	NOISE MONITORING LOCATIONS	9
	3.3	ASSESSMENT METHODOLOGY	9
4	R	ESULTS	11
	4.1	ASSESSMENT RESULTS - LOCATION R6	11
	4.2	ASSESSMENT RESULTS - LOCATION R7	11
	4.3	ASSESSMENT RESULTS - LOCATION R8	12
5	D	ISCUSSION	13
	5.1	DISCUSSION OF RESULTS - LOCATION R6	13
	5.2	DISCUSSION OF RESULTS - LOCATION R7	13
	5.3	DISCUSSION OF RESULTS - LOCATION R8	13
6	С	ONCLUSION	15

APPENDIX A - GLOSSARY OF TERMS





1 Introduction

Muller Acoustic Consulting Pty Ltd (MAC) has been commissioned by Holcim (Australia) Pty Ltd (Holcim) to complete a Noise Monitoring Assessment (NMA) for the quarterly period ending September 2022 for Dunloe Quarry (the 'quarry'), Pottsville, NSW.

The monitoring has been conducted in accordance with the Dunloe Project Approval 06_0030, Modification (2018) and Noise Management Plan (2020) at three representative monitoring locations. This assessment represents the operations undertaken during Quarter 3, ending September 2022 and forms part of the annual noise monitoring program to address conditions of the project approval.

The assessment has been conducted in accordance with the following documents:

- NSW Environment Protection Authority (EPA), Noise Policy for Industry (NPI), 2017;
- NSW Environment Protection Authority (EPA), Environmental Protection License (EPL), 13077, 2018;
- NSW Department of Planning, Project Approval 06_0030, Modification 2018;
- GHD, Dunloe Sand Quarry Noise Management Plan (NMP), 2020; and
- Australian Standard AS 1055:2018- Acoustics Description and measurement of environmental noise - General Procedures.

A glossary of terms, definitions and abbreviations used in this report is provided in Appendix A.





2 Noise Criteria

Table 4.1 of Dunloe Sand Quarry's NMP, (2020) outlines the updated applicable noise criteria for residential receivers surrounding the quarry site.

The noise criteria are applicable when the site undertakes quarrying operations within the permitted operating hours Monday to Friday 7am – 5pm, Saturday 7am – 12pm with no operations on Sunday.

Table 1 presents the noise criteria for each of the receivers as outlined in Table 4.1 of the NMP (2020).

Table 1 Noise Criteria						
Location	Day Criteria dB LAeq(15min) ²					
R6 and R7	42					
R8	48					
All privately-owned receivers ¹	41					

Note 1: Receiver locations are shown in Figure 1.

Note 2: Criteria applicable between Monday to Friday 7am – 5pm, Saturday 7am – 12pm with no operations on Sunday as the Table 4.1 of the NMP (2020)

2.1 Environmental Protection License (EPL 13077)

Compliance with the noise criteria in the NMP would also result in compliance with the EPL noise limits (EPL 13077) which requires noise contribution from the quarry not to exceed 48dB LAeq(15min) at any residential receiver.





3 Methodology

3.1 Locality

The quarry is approximately 2.5km south west of Pottsville, NSW. Receivers surrounding the quarry are primarily rural/residential situated in coastal bushland with elevated and undulating topography. The monitoring locations with respect to the quarry and assessed receivers are presented in the locality plan shown in Figure 1.

3.2 Noise Monitoring Locations

Three monitoring locations have been selected as part of the NMA and are listed below:

- R6 is located at 157 Warwick Park Road;
- R7 is located at 129 Warwick Park Road; and
- R8 is located at 679 Pottsville Road.


3.3 Assessment Methodology

Attended noise surveys were conducted in general accordance with the procedures described in Australian Standard AS 1055:2018, "Acoustics - Description and Measurement of Environmental Noise and Dunloe Quarry's Project Approval. Measurements were carried out using a Svantek Type 1, 971 noise analyser on Wednesday 31 August 2022. Acoustic instrumentation used carries current NATA calibration and complies with AS/NZS IEC 61672.1-2019-Electroacoustics - Sound level meters - Specifications. Calibration of all instrumentation was checked prior to and following measurements. Drift in calibration did not exceed ±0.5dBA.

One measurement was conducted at each monitoring location during the daytime period. Measurements were of 15 minutes in duration and where possible, throughout each survey the operator quantified the contribution of each significant noise source.

Extraneous noise sources were excluded from the analysis to determine the LAeq(15min) quarry noise contribution for comparison against the relevant criteria. Where the quarry was inaudible, the contribution is estimated to be at least 10dB below the ambient noise level.



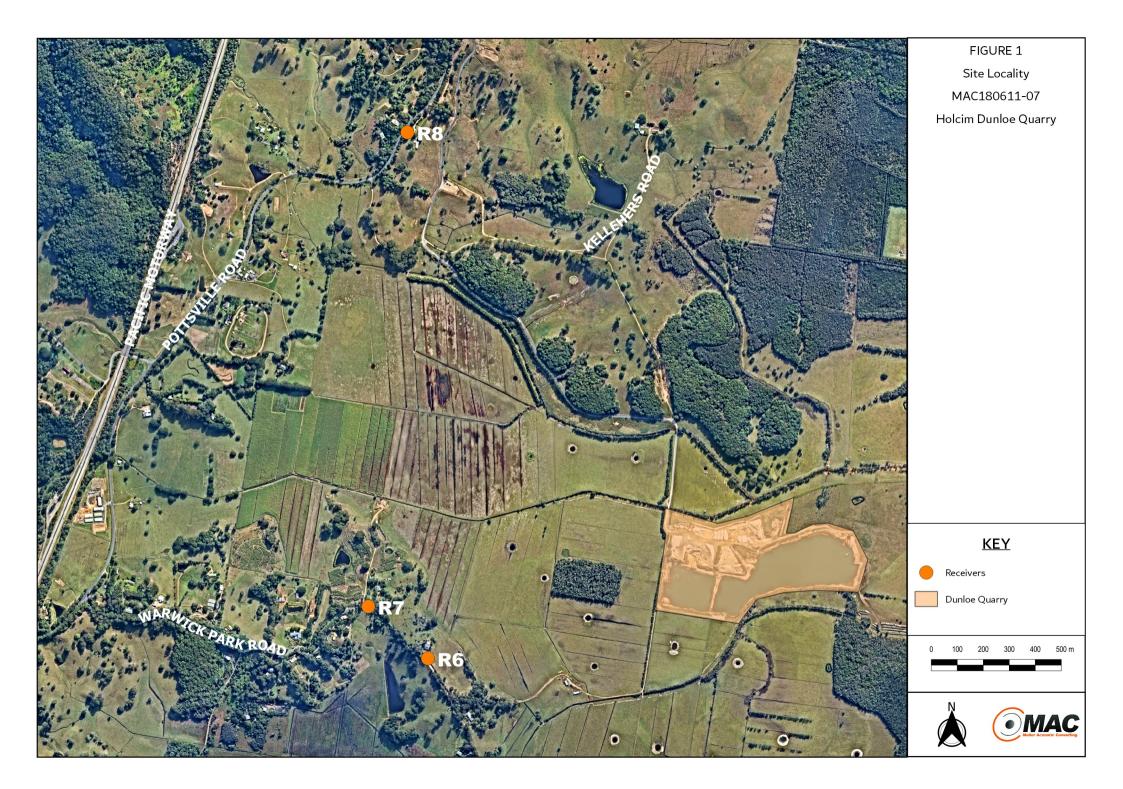

4 Results

4.1 Assessment Results - Location R6

The monitored noise level contributions and observed meteorological conditions for R6 are presented in Table 2.

		Descriptor (dBA re 20 µPa)				
Date Time (hrs)	Time (hrs)	LAmax	LAeq	LA90	Meteorology	Description and SPL, dBA
	11					Insects <38
31/08/2022	12:36 (Day)				WD: NW	Birds 41-54
		81 6	63	42	WS: 0.2m/s	Traffic 38-81
					Rain: Nil	Aircraft 38-46
						Quarry inaudible
Dunloe Quarry LAeq(15min) Contribution						<30

4.2 Assessment Results - Location R7

The monitored noise level contributions and observed meteorological conditions for R7 are presented in Table 3.

Table 3 Operator-Attended Noise Survey Results – Location R7						
Date Time (hrs	Time (bra)	Descriptor (dBA re 20 µPa)			Mataaralaay	Description and SPL, dBA
	Time (TIIS)	LAmax	LAeq	LA90	Meteorology	Description and SFE, dBA
31/08/2022	13:00 (Day)	64 42		37	WD: NW WS: 0.2m/s Rain: Nil	Traffic 34-38
			42			Birds 34-64
						Aircraft 34-42
						Quarry inaudible
Dunloe Quarry LAeq(15min) Contribution						<30



4.3 Assessment Results - Location R8

The monitored noise level contributions and observed meteorological conditions for R8 are presented in Table 4.

Table 4 Operator-Attended Noise Survey Results – Location R8						
Date	Time (hrs)	Descriptor (dBA re 20 µPa)			Meteorology	Description and SPL, dBA
		LAmax	LAeq	LA90	Meteorology	Description and SFE, dBA
			-			Wind in trees 36-44
31/08/2022	13:19 (Day)	64 45	45	38	WD: NW WS: 0.8m/s Rain: Nil	Traffic 36-64
						Birds 37-45
						Dog bark 38-42
					Rain. Nii	Aircraft 36-46
						Quarry inaudible
Dunloe Quarry LAeq(15min) Contribution						<30



5 Discussion

5.1 Discussion of Results - Location R6

Quarry noise emissions were inaudible during monitoring conducted on Wednesday 31 August 2022 at location R6. The (in field) estimated quarry noise contribution satisfied the relevant daytime noise limit of 42dB LAeq(15min). Extraneous noise sources include insects, birds, traffic and aircraft during the monitoring period.

5.2 Discussion of Results - Location R7

Quarry noise emissions were inaudible during monitoring conducted on Wednesday 31 August 2022 at location R7. The (in field) estimated quarry noise contribution satisfied the relevant daytime noise limit of 42dB LAeq(15min). Extraneous noise sources include traffic, birds and aircraft during the monitoring period.

5.3 Discussion of Results - Location R8

Quarry noise emissions were inaudible during monitoring conducted on Wednesday 31 August 2022 at location R8. The (in field) estimated quarry noise contribution satisfied the relevant daytime noise limit of 48dB LAeq(15min). Extraneous noise sources include wind in trees, traffic, birds, dog bark and aircraft during the monitoring period.





6 Conclusion

Muller Acoustic Consulting Pty Ltd (MAC) has completed a Noise Monitoring Assessment (NMA) on behalf of Holcim (Australia) Pty Ltd at Dunloe Quarry, Pottsville, NSW. The assessment was completed to determine the quarry's compliance with the relevant criteria outlined in the Dunloe Project Approval 06_0030, Modification (2018) at relevant surrounding residential receivers for Quarter 3, ending September 2022.

Attended noise monitoring was undertaken on Wednesday 31 August 2022 at three representative monitoring locations, with quarry noise contributions compared against the relevant criteria. The assessment has identified that noise emissions generated by Dunloe Quarry complies with the relevant noise criteria specified in the NMP (2020) and EPL at all assessed residential receivers.





Appendix A - Glossary of Terms



Table A1 provides a number of technical terms have been used in this report.


Term	Description					
1/3 Octave	Single octave bands divided into three parts					
Octave	A division of the frequency range into bands, the upper frequency limit of each band being twice					
	the lower frequency limit.					
ABL	Assessment Background Level (ABL) is defined in the NPI as a single figure background level for					
	each assessment period (day, evening and night). It is the tenth percentile of the measured LA90					
	statistical noise levels.					
Adverse Weather	Weather effects that enhance noise (that is, wind and temperature inversions) that occur at a site					
	for a significant period of time (that is, wind occurring more than 30% of the time in any					
	assessment period in any season and/or temperature inversions occurring more than 30% of the					
	nights in winter).					
Ambient Noise	The noise associated with a given environment. Typically a composite of sounds from many					
	sources located both near and far where no particular sound is dominant.					
A Weighting	A standard weighting of the audible frequencies designed to reflect the response of the human					
	ear to noise.					
dBA	Noise is measured in units called decibels (dB). There are several scales for describing noise, the					
	most common being the 'A-weighted' scale. This attempts to closely approximate the frequency					
	response of the human ear.					
dB(Z), dB(L)	Decibels Linear or decibels Z-weighted.					
Hertz (Hz)	The measure of frequency of sound wave oscillations per second - 1 oscillation per second					
	equals 1 hertz.					
LA10	A noise level which is exceeded 10 % of the time. It is approximately equivalent to the average of					
	maximum noise levels.					
LA90	Commonly referred to as the background noise, this is the level exceeded 90 % of the time.					
LAeq	The summation of noise over a selected period of time. It is the energy average noise from a					
	source, and is the equivalent continuous sound pressure level over a given period.					
LAmax	The maximum root mean squared (rms) sound pressure level received at the microphone during a					
	measuring interval.					
RBL	The Rating Background Level (RBL) is an overall single figure background level representing					
	each assessment period over the whole monitoring period. The RBL is used to determine the					
	intrusiveness criteria for noise assessment purposes and is the median of the ABL's.					
Sound power level (LW)	This is a measure of the total power radiated by a source. The sound power of a source is a					
	fundamental location of the source and is independent of the surrounding environment. Or a					
	measure of the energy emitted from a source as sound and is given by :					
	= 10.log10 (W/Wo)					
	Where : W is the sound power in watts and Wo is the sound reference power at 10-12 watts.					



Table A2 Common Noise Sources and Their Typical Soun	d Pressure Levels (SPL), dBA
Source	Typical Sound Level
Threshold of pain	140
Jet engine	130
Hydraulic hammer	120
Chainsaw	110
Industrial workshop	100
Lawn-mower (operator position)	90
Heavy traffic (footpath)	80
Elevated speech	70
Typical conversation	60
Ambient suburban environment	40
Ambient rural environment	30
Bedroom (night with windows closed)	20
Threshold of hearing	0

 Table A2 provides a list of common noise sources and their typical sound level.



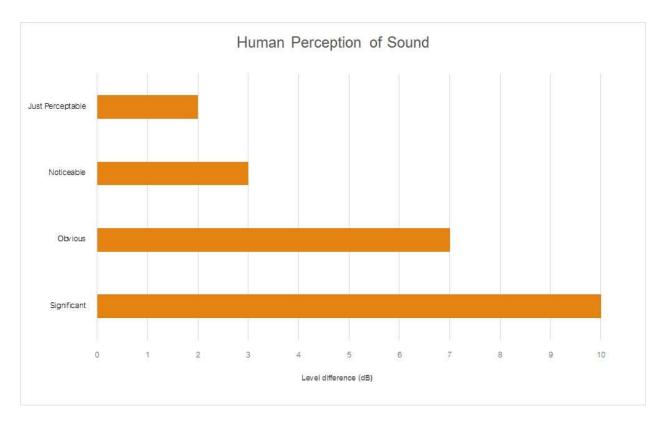



Muller Acoustic Consulting Pty Ltd PO Box 678, Kotara NSW 2289 ABN: 36 602 225 132 Ph: +61 2 4920 1833 www.mulleracoustic.com

