Noise Monitoring Assessment

Cooma Road Quarry, Googong, NSW Quarter 1 Ending March 2020.



Document Information

Noise Monitoring Assessment

Cooma Road Quarry, Googong, NSW

Quarter 1 Ending March 2020

Prepared for: Holcim (Australia) Pty Ltd

Prepared by: Muller Acoustic Consulting Pty Ltd

PO Box 262, Newcastle NSW 2300

ABN: 36 602 225 132 P: +61 2 4920 1833

www.mulleracoustic.com

Document ID	Status	Date	Prepared By	Signed	Reviewed By	Signed
MAC180611-03RP7	Final	17 February 2020	Kristian Allen	Kller	Rod Linnett	RM LAH

DISCLAIMER

All documents produced by Muller Acoustic Consulting Pty Ltd (MAC) are prepared for a particular client's requirements and are based on a specific scope, circumstances and limitations derived between MAC and the client. Information and/or report(s) prepared by MAC may not be suitable for uses other than the original intended objective. No parties other than the client should use or reproduce any information and/or report(s) without obtaining permission from MAC. Any information and/or documents prepared by MAC is not to be reproduced, presented or reviewed except in full.



CONTENTS

1	11	NTRODUCTION	5
2	N	IOISE CRITERIA	/
3	N	METHODOLOGY	9
	3.1	LOCALITY	9
	3.2	NOISE MONITORING LOCATIONS	9
	3.3	ASSESSMENT METHODOLOGY	10
4	R	RESULTS	13
	4.1	ASSESSMENT RESULTS - LOCATION N3	13
	4.2	ASSESSMENT RESULTS - LOCATION N8	14
	4.3	ASSESSMENT RESULTS - LOCATION N38	15
	4.4	ASSESSMENT RESULTS - LOCATION N60	16
	4.5	ASSESSMENT RESULTS - LOCATION N67	17
5	D	DISCUSSION	19
	5.1	DISCUSSION OF RESULTS - LOCATION N3	19
	5.2	DISCUSSION OF RESULTS - LOCATION N8	19
	5.3	DISCUSSION OF RESULTS - LOCATION N38	19
	5.4	DISCUSSION OF RESULTS - LOCATION N60	20
	5.5	DISCUSSION OF RESULTS - LOCATION N67	20
6	С	CONCLUSION	21

APPENDIX A - GLOSSARY OF TERMS





1 Introduction

Muller Acoustic Consulting Pty Ltd (MAC) has been commissioned by Holcim (Australia) Pty Ltd (Holcim) to complete a Noise Monitoring Assessment (NMA) for Cooma Road Quarry the 'quarry', Googong, NSW.

The monitoring has been conducted in accordance with the quarry Noise Management Plan and in general accordance with Development Consent (SSD-5109); at five representative monitoring locations. This assessment has been undertaken for the quarterly period ending March 2020 and forms part of the annual noise monitoring program for the quarry.

The assessment has been conducted in accordance with the following documents:

- NSW Environment Protection Authority (EPA), Noise Policy for Industry (NPI), 2017;
- Cooma Road Quarry, Noise Management Plan (NMP), 2014;
- Development Consent SSD-5109; and
- Australian Standard AS 1055:2018 Acoustics Description and measurement of environmental noise.

A glossary of terms, definitions and abbreviations used in this report is provided in **Appendix A**.





2 Noise Criteria

Schedule 3, Condition 4 of the Cooma Road Quarry Development Consent, approved on 27 September 2013, outlines the applicable noise criteria for residential receivers N1 – N71 surrounding the quarry and are presented in **Table 1**.

Table 1 Noise Criteria						
	Morning Shoulder	Day	Evening			
Receivers	6am – 7am	7am – 6pm	6pm – 10pm			
	dB LAeq(15min)	dB LAeq(15min)	dB LAeq(15min)			
N1, N7, N8, N56, N57, N59, N63, N64, N65	40	44	39			
N67	36	41	35			
All other Receivers between N9 and N71	36	38	35			
inclusive	30	36	35			
All other Receivers	35	35	35			





3 Methodology

3.1 Locality

The quarry is located in Googong, NSW approximately 13km south east of Canberra, ACT. The quarry is bounded primarily by rural and residential properties in all directions, with noise from passing road traffic on Old Cooma Road dominating the acoustic environment for receivers to the east of the quarry. The monitoring locations with respect to the quarry and assessed receivers are presented in the locality plan shown in **Figure 1**.

3.2 Noise Monitoring Locations

Five monitoring locations have been selected as part of the NMA and in accordance with the Development Consent.

Location N3 is to the west of the quarry situated on a rural property off Copperfield Place. This location represents residential and rural receivers to the west of the quarry.

Location N8 is to the north east of the quarry along Tempe Crescent and is representative of residential receivers in that area.

Location N38 is on Heights Road and is representative of the elevated residential receivers to the east of the quarry.

Location N60 is at 501 Old Cooma Road and represents the residence adjacent to the quarry access road.

Location N67 is situated on a rural property at 732 Old Cooma Road to the south of the quarry. This is representative of rural and residential receivers to the south, with direct line of site into the quarry pit.



3.3 Assessment Methodology

Attended noise surveys were conducted in general accordance with the procedures described in Australian Standard AS 1055:2018, "Acoustics - Description and Measurement of Environmental Noise" and the EPL. Measurements were carried out using Svantek Type 1, 971 noise analysers from Wednesday 5 February 2020 to Thursday 6 February 2020. The acoustic instrumentation used carries current NATA calibration and complies with AS IEC 61672.1-2019-Electroacoustics - Sound level meters - Specifications. Calibration of all instrumentation was checked prior to and following measurements. Drift in calibration did not exceed ±0.5dBA.

Noise measurements were of 15-minutes in duration and where possible, throughout each survey the operator quantified the contribution of each significant noise source. One measurement was conducted at each monitoring location during the day, evening and morning shoulder periods.

Extraneous noise sources were excluded from the analysis to calculate the LAeq(15min) quarry noise contribution for comparison against the relevant criteria.

Where the quarry is inaudible, the contribution is estimated to be at least 10dBA below the ambient noise level.









4 Results

4.1 Assessment Results - Location N3

The monitored noise level contributions and observed meteorological conditions for each assessment period at location N3 for the NMA are presented in **Table 2**.

Table 2 Operator-Attended Noise Survey Results – Location N3							
Date	T: (b)	Descriptor (dBA re 20 μPa)			Mata a sala su .	December and CDL alDA	
Date	Time (hrs)	LAmax	LAeq	LA90	Meteorology	Description and SPL, dBA	
						Birds 36-57	
	06:36				WD: E	Distant Traffic 33-38	
05/02/2020	(Morning	57	38	35	WS: Calm	Urban Hum <30	
	Shoulder)				Rain: Nil	Dogs 33-44	
						Quarry Not Audible	
	Cooma F	<30					
						Aircraft 34-57	
	11:46 (Day)	57	41	31	WD: SE	Distant Traffic <30	
05/02/2020					WS: 1.0m/s	Urban Hum <30	
					Rain: Nil	Birds 35-42	
						Quarry Not Audible	
	Cooma F	Road Quarr	y LAeq(15n	nin) Contribut	ion	<30	
						Wind 30-54	
	10.40				WD: NE	Birds 30-42	
05/02/2020	18:48 (Evening)	62	46	37	WS: 2.5m/s	Aircraft 39-62	
					Rain: Nil	Distant Traffic <30	
						Urban Hum <30	
	Cooma Road Quarry LAeq(15min) Contribution Quarry Not Operating						



4.2 Assessment Results - Location N8

The monitored noise level contributions and observed meteorological conditions for each assessment period at location N8 for the NMA are presented in **Table 3**.

able 3 Ope	rator-Attend	ed Noise	Survey R	tesults – Lo	cation N8		
Date	Time (hrs)	Descriptor (dBA re 20 µPa)			Meteorology	Description and SPL, dB	
Date	Time (ms)	LAmax	LAeq	LA90	Meteorology	Description and SFL, db/	
	06:18				WD: S	Traffic 39-69	
20/00/0000		00	FO	45		Birds 43-57	
06/02/2020	(Morning	69	53	45	WS: 0.5m/s	Dogs 48-56	
	Shoulder)	Shoulder)				Rain: Nil	Quarry Not Audible
	Cooma F	<35					
	11:00				MD NE	Traffic 40-79	
25/00/0000		79	E.4	54 39	WD: NE WS: 0.5m/s	Birds 44-61	
05/02/2020	(Day)		54			Aircraft 43-52	
					Rain: Nil	Quarry Not Audible	
	Cooma F	Road Quarr	y LAeq(15n	nin) Contributi	on	<35	
					MD. F	Birds 38-74	
	20:09 74 (Evening)	7.4		40 WS: 1.	WD: E	Traffic 32-58	
05/02/2020		74	57		WS: 1.0m/s	Dogs 48-74	
					Rain: Nil	Wind 35-52	
	Cooma F	Road Quarr	y LAeq(15n	nin) Contributi	on	Quarry Not Operating	



4.3 Assessment Results - Location N38

The monitored noise level contributions and observed meteorological conditions for each assessment period at location N38 for the NMA are presented in **Table 4**.

Table 4 Operator-Attended Noise Survey Results – Location N38						
Date	T: /b	Descriptor (dBA re 20 µPa)			Meteorology	Description and SPL, dBA
Date	Time (hrs)	LAmax	LAeq	LA90	Weteorology	Description and SFL, dBA
	06:37				WD: SW	Traffic 36-81
06/02/2020	(Morning	81	56	46	WS: 0.5m/s	Birds 35-55
	Shoulder)				Rain: Nil	Quarry Not Audible
	Cooma F	<35				
	10:41				WD: NE	Traffic 37-66
05/00/0000		00	40	39	WS: 0.5m/s	Dogs 42-54
05/02/2020	(Day)	66	49			Birds 35-57
					Rain: Nil	Quarry Not Audible
	Cooma F	Road Quarr	y LAeq(15n	nin) Contribut	ion	<35
	19:50				WD: NE	Traffic 32-77
05/02/2020		77	52	38	WS: 1.0m/s	Wind 35-44
	(Evening)				Rain: Nil	Birds 38-46
	Cooma F	Quarry Not Operating				



4.4 Assessment Results - Location N60

The monitored noise level contributions and observed meteorological conditions for each assessment period at location N60 for the NMA are presented in **Table 5**.

Table 5 Operator-Attended Noise Survey Results – Location N60						
Date	Time (hrs)	Descriptor (dBA re 20 μPa)			- Meteorology	Description and SPL, dBA
Date	Time (ms)	LAmax	LAeq	LA90	Weteorology	Description and St. E, dBA
	06:00				WD: S	Traffic 36-59
00/00/0000		00	60	40		Vehicles Entering/Exiting Quarry 40-86
06/02/2020	(Morning	86	63	42	WS: 0.5m/s	Birds 38-52
	Shoulder)				Rain: Nil	Quarry Not Audible
Cooma Road Quarry LAeq(15min) Contribution						<35
	11:20			05 40	WD. F	Traffic 38-55
05/00/0000		0.4	C.F.		WD: E	Vehicles Entering/Exiting Quarry 40-84
05/02/2020	(Day)	84	65	42	WS: 1.0m/s	Birds<35
				Rain: Nil	Quarry Not Audible	
	Cooma Road	Quarry LA	eq(15min) C	ontribution		<35
	20:31				WD: SE	Traffic 30-64
05/02/2020		71	50	39	WS: 1.5m/s	Vehicles Entering Quarry 40-71
	(Evening)				Rain: Nil	Wind 33-47
	Cooma Road	Quarry Not Operating				



4.5 Assessment Results - Location N67

The monitored noise level contributions and observed meteorological conditions for each assessment period at location N67 for the NMA are presented in **Table 6**.

Time (hrs)		o. (ab	20 μPa)	Motoorology	Description and CDL dD
	LAmax	LAeq	LA90	Meteorology	Description and SPL, dB/
06:00				WD: SE	Distant Traffic 30-39
	E.4	00	0.5		Birds 35-54
(Morning	54	38	35	WS: <0.5m/s	Insects <30
Shoulder)				Rain: Nil	Quarry Vehicle 34-37
Cooma F	Road Quarr	y LAeq(15n	nin) Contributi	on	<35
10:13 05/02/2020 57 (Day)		38 31			Birds 34-41
	57		31	WD: N	Aircraft 36-57
				WS: 0.5m/s	Distant Traffic 31-37
			Rain: Nil	Quarry Site Alarms 34-37	
					Rock Tipping 30-32
Cooma F	Road Quarr	y LAeq(15n	nin) Contributi	on	<35
				MD. NE	Wind 30-51
19:25 (Evening)	19:25 63 42 36 WS: 2.0 (Evening)	40	0.0		Birds 35-38
			Distant Traffic 30-35		
				Raın: Nıl	Aircraft 38-63
	Shoulder) Cooma F 10:13 (Day) Cooma F 19:25 (Evening)	Shoulder) Cooma Road Quarr 10:13 57 (Day) Cooma Road Quarr 19:25 63 (Evening)	Shoulder) Cooma Road Quarry LAeq(15m 10:13 57 38 (Day) Cooma Road Quarry LAeq(15m 19:25 63 42 (Evening)	Shoulder) Cooma Road Quarry LAeq(15min) Contribution 10:13 57 38 31 (Day) Cooma Road Quarry LAeq(15min) Contribution 19:25 63 42 36 (Evening)	Shoulder) Rain: Nil Cooma Road Quarry LAeq(15min) Contribution WD: N 10:13





5 Discussion

5.1 Discussion of Results - Location N3

Quarry noise was inaudible during all three measurements conducted at location N3. Quarry noise contributions were estimated to satisfy the relevant morning shoulder and daytime criteria.

It is noted that the quarry was not operational during the evening period therefore satisfying the evening criteria of 35dB LAeq(15min). Extraneous noise sources audible during the survey included birds, dogs barking, wind in trees, urban hum, distant traffic and aircraft noise.

5.2 Discussion of Results - Location N8

Noise levels were dominated by generally constant traffic on Old Cooma Road during all three measurements. Quarry noise was inaudible during short breaks in traffic for all three measurements. Quarry noise contributions were estimated to satisfy the relevant morning shoulder and daytime criteria.

The quarry was not operational during the evening period therefore satisfying the evening noise limit of 39dB LAeq(15min). Extraneous noise sources audible during the survey included wind in trees, birds, traffic, aircraft noise and dogs barking.

5.3 Discussion of Results - Location N38

Noise levels were dominated by generally constant traffic on Old Cooma Road during all three measurements. Quarry noise was inaudible during short breaks in traffic for all three measurements. Quarry noise contributions were estimated to satisfy the relevant morning shoulder and daytime criteria.

The quarry was not operational during the evening period therefore satisfying the evening criteria of 35dB LAeq(15min). Extraneous noise sources audible during the survey included wind in trees, traffic, dogs barking, birds and traffic.



5.4 Discussion of Results - Location N60

Noise levels were dominated by generally constant traffic on Old Cooma Road during all three measurements. Quarry noise was inaudible during short breaks in traffic for all three measurements conducted at location N60. Quarry noise contributions were estimated to satisfy the relevant morning shoulder and daytime criteria.

It is noted that the quarry was not operational during the evening period therefore satisfying the evening criteria of 35dB LAeq(15min). Extraneous noise sources audible during the survey included vehicles entering and exiting site, birds, wind in trees and traffic.

5.5 Discussion of Results - Location N67

Quarry noise emissions were audible during the morning shoulder and daytime measurement at N67. Quarry emissions were estimated at <35dBA for morning shoulder and daytime measurements, therefore satisfying relevant noise limits. Audible quarry sources included truck movements, site alarms and rock tipping.

It is noted that the quarry was not operational during the evening period, therefore satisfying the evening noise limit of 35dB LAeq(15min). Extraneous noise sources audible during the survey included birds, insects, aircraft noise, distant traffic and wind in trees.



6 Conclusion

Muller Acoustic Consulting Pty Ltd (MAC) has completed a Noise Monitoring Assessment (NMA) for Holcim (Australia) Pty Ltd at the Cooma Road Quarry, Googong, NSW. The assessment was completed to assess the quarry's compliance with the relevant noise criteria outlined in their Development Consent for residential receivers surrounding the quarry.

Attended monitoring was undertaken from Wednesday 5 February 2020 to Thursday 6 February 2020 at five representative monitoring locations. The assessment has identified that noise emissions generated by Cooma Road Quarry comply with relevant noise criteria specified in the Development Consent at all assessed residential receivers for the quarterly period ending March 2020.





Appendix A - Glossary of Terms



 Table A1 provides a number of technical terms have been used in this report.


Term	Description
1/3 Octave	Single octave bands divided into three parts
Octave	A division of the frequency range into bands, the upper frequency limit of each band being twice
	the lower frequency limit.
ABL	Assessment Background Level (ABL) is defined in the NPI as a single figure background level for
	each assessment period (day, evening and night). It is the tenth percentile of the measured LA90
	statistical noise levels.
Adverse Weather	Weather effects that enhance noise (that is, wind and temperature inversions) that occur at a site
	for a significant period of time (that is, wind occurring more than 30% of the time in any
	assessment period in any season and/or temperature inversions occurring more than 30% of the
	nights in winter).
Ambient Noise	The noise associated with a given environment. Typically a composite of sounds from many
	sources located both near and far where no particular sound is dominant.
A Weighting	A standard weighting of the audible frequencies designed to reflect the response of the human
	ear to noise.
dBA	Noise is measured in units called decibels (dB). There are several scales for describing noise, the
	most common being the 'A-weighted' scale. This attempts to closely approximate the frequency
	response of the human ear.
dB(Z), dB(L)	Decibels Linear or decibels Z-weighted.
Hertz (Hz)	The measure of frequency of sound wave oscillations per second - 1 oscillation per second
	equals 1 hertz.
LA10	A noise level which is exceeded 10 % of the time. It is approximately equivalent to the average of
	maximum noise levels.
LA90	Commonly referred to as the background noise, this is the level exceeded 90 % of the time.
LAeq	The summation of noise over a selected period of time. It is the energy average noise from a
	source, and is the equivalent continuous sound pressure level over a given period.
LAmax	The maximum root mean squared (rms) sound pressure level received at the microphone during a
	measuring interval.
RBL	The Rating Background Level (RBL) is an overall single figure background level representing
	each assessment period over the whole monitoring period. The RBL is used to determine the
	intrusiveness criteria for noise assessment purposes and is the median of the ABL's.
Sound power level (LW)	This is a measure of the total power radiated by a source. The sound power of a source is a
	fundamental location of the source and is independent of the surrounding environment. Or a
	measure of the energy emitted from a source as sound and is given by :
	= 10.log10 (W/Wo)
	Where: W is the sound power in watts and Wo is the sound reference power at 10-12 watts.



Table A2 provides a list of common noise sources and their typical sound level.

able A2 Common Noise Sources and Their Typical Sound Pressure Levels (SPL), dBA						
Source	Typical Sound Level					
Threshold of pain	140					
Jet engine	130					
Hydraulic hammer	120					
Chainsaw	110					
Industrial workshop	100					
Lawn-mower (operator position)	90					
Heavy traffic (footpath)	80					
Elevated speech	70					
Typical conversation	60					
Ambient suburban environment	40					
Ambient rural environment	30					
Bedroom (night with windows closed)	20					
Threshold of hearing	0					

Figure A1 – Human Perception of Sound

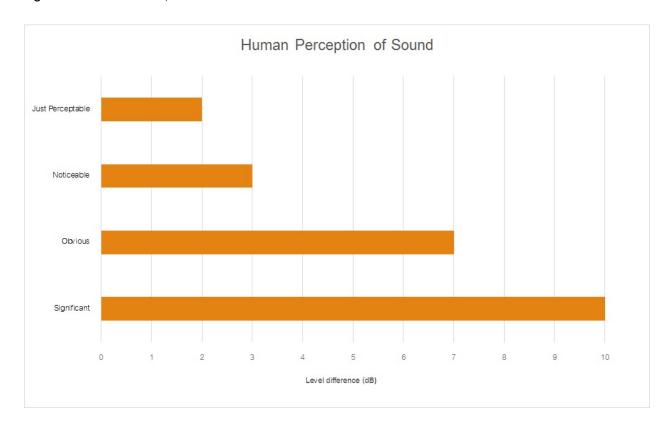





ABN: 36 602 225 132 P: +61 2 4920 1833 www.mulleracoustic.com

